

Customer Service Bulletin

SLM Electronics, Inc. Saint Louis, Missouri

Oct 27, 1998

CSB0006

Units Affected:

<u>Model</u>	<u>Serial Number</u>
Audio Centron RMA-1650	ARODK80001 through ARODK80024
Audio Centron RMA-1601	ARNDK80001 through ARNDK80044

Concern:

Internal fuses in these production units can fail after repeated on/off cycling

Corrective Actions:


OPTION A - RETURN UNIT FOR MODIFICATION OR REPLACEMENT:

1. To have your unit **modified** and returned to you, contact the SLM Electronics Factory Service Center at **1-800-738-7563**.
2. For **replacement** of your unit contact St. Louis Music at **1-800-727-4512**. (You may talk to your regular inside sales representative.)

OPTION B - MODIFY UNIT:

1. Unplug the unit.
2. Remove the 9/64" drive socket screw from the top-center of the faceplate. Remove the ten small phillips-head screws from the top cover (three along each side, three along the rear, and one on the top). Remove the top cover.
3. Locate the four internal fuses (F1 - F4), remove them as shown in Figure 1 on page 2 and discard them.
4. Replace each of the four fuses with SLM part number 23-301-05 3AG 1A slo blo fuses. (Note that even though the replacement fuses are longer than the original fuses, they still snap down into the same fuse holders.)
5. Replace the top cover and tighten the screws. Do not overtighten.

Figure 1: Removal of the internal fuses

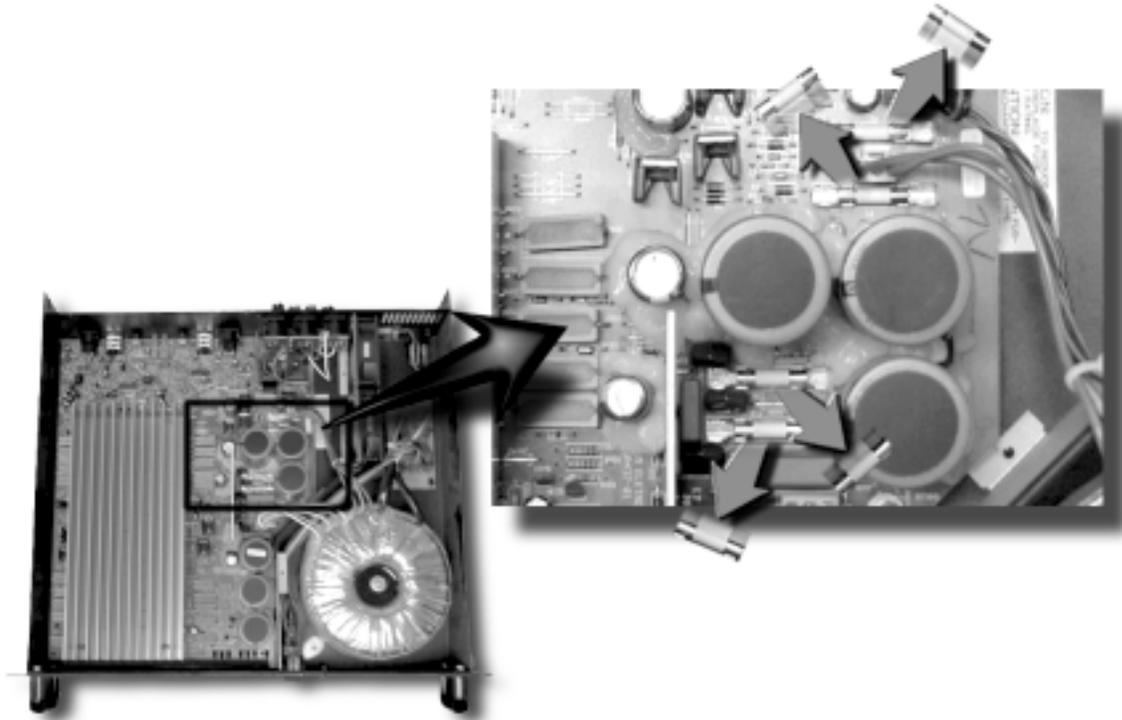

Remove T1A fuses, four places (F1 - F4) - replace with 3AG 1A slo-blo #23-301-05.

SLM Electronics, A Division of St. Louis Music, Inc
11880 Borman Drive, St. Louis, MO 63146
Phone (314) 569-0141
Service Department: Phone (800) 738-7563; Fax (314) 567-7278