

# Customer Service Bulletin

SLM Electronics, Inc. Saint Louis, Missouri

---

August 17, 1999

# CSB0013

## Units Affected:

<u>Model</u>	<u>Serial Number</u>
SVT-2PRO	ATLDDL10001 through ATLDDL10020 ATLDDL40001 through ATLDDL40032
SVT-CL	TCLDL10001 through TCLDL10050 TCLDL30001 through TCLDL30055 TCLDL40001 through TCLDL40030

## Purpose:

Some units may fail to work when the power tube socket(s) solder joints fracture due to mechanical stress.

## Recommended Actions:

1. Contact your local Factory Authorized Service Center for service on these units.  

**Or**
2. To have your unit updated and returned to you, please contact the SLM Electronics Factory Service Center at **1-800-738-7563**.

## Corrective Action:

***NOTE: Use standard anti-static precautions when working with the PCB.***

1. Unplug the unit.
2. Disassemble the unit and remove the power tube PCB (SLME #07-419-41).
3. Inspect all solder joints on the tube sockets. Minimally resolder the power tube socket joints.
4. Reinstall the power tube PCB and reassemble the entire unit.

SLM Electronics, A Division of St. Louis Music, Inc.  
11880 Borman Drive, St. Louis, MO 63146  
Phone (314) 569-0141  
Service Department: Phone (800) 738-7563; Fax (314) 567-7278